






EQUIPPED WITH QUICK-RELEASE

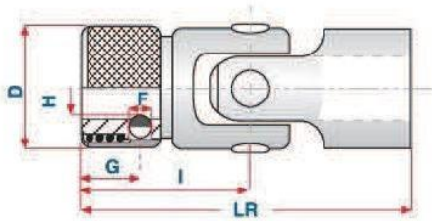


HUB - BORINGS FOR QUICK-RELEASE

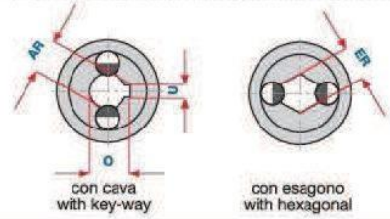


type	D	AR Ø	ER	O x U	FO	G	H	I	LR
S 20.10 R AR	20,5	9		10,2 x 3	4,5	13	8	27,5	52
S 20.10 R AR	20,5	9		10,2 x 3	4,5	13	8	31	62
S 20.10 R AR	20,5	10	10	11,2 x 3	4	13	9	27,5	52
S 20.10 R AR	20,5	10	10	11,2 x 3	4	13	9	31	62
S 26.14 R AR	26,5	12	12	13,3 x 4	4	13,5	13	32	74
S 26.14 R AR	26,5	14	14	15,3 x 5	4	13,5	13	37	74
S 32.16 R AR	32,5	16	16	17,3 x 5	6,35	14	14,8	43	86
S 40.18 R AR	40,5	18	18	20,8 x 6	8,73	20	16,5	54	108
S 40.20 R AR	40,5	20	20	21,7 x 6	8	19	18	54	108
S 50.22 R AR	52,5	22	22	24,8 x 6	12	22,5	19,2	66	132
S 50.25 R AR	50,5	25	25	28,3 x 8	10	20,5	23	66	132
S 50.28 R AR	50,5	28		30 x 8	8,8	20,5	25,5	66	132

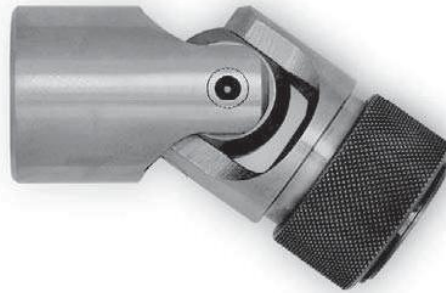

EQUIPPED WITH QUICK-RELEASE

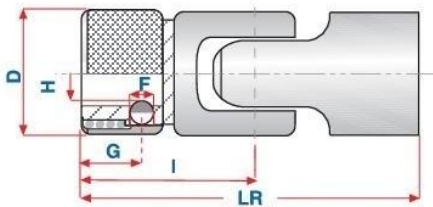

HUB - BORINGS FOR QUICK-RELEASE

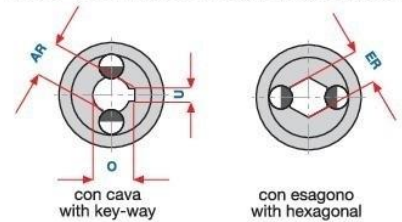

type	D	AR Ø	ER	O x U	F Ø	G	H	I	LR
S20.9 AR	20,5	9		10,2 x 3	4,5	13	8	27,5	50
S20.9 AR	20,5	9		10,2 x 3	4,5	13	8	31	62
S20.10 AR	20,5	10	10	11,2 x 3	4	13	9	27,5	50
S20.10 AR	20,5	10	10	11,2 x 3	4	13	9	31	62
S23.12 AR	23,5	12	12	13,3 x 4	4	13	11	30	55
S26.14 AR	26,5	14	14	15,3 x 5	4	13,5	13	32	60
S26.14 AR	26,5	14	14	15,3 x 5	4	13,5	13	37	74
S32.14 AR	31	14	14	15,4 x 5	4,5	13	12,5	39	73
S32.16 AR	32,5	16	16	17,3 x 5	6,35-1/4	14	14,8	41	77
S32.16 AR	32,5	16	16	17,3 x 5	6,35-1/4	14	14,8	43	86
S40.18 AR	40,5	18	18	20,8 x 6	8	19	16,5	50,5	98
S40.20 AR	40,5	20	20	21,7 x 6	8	19	18	50,5	98
S40.22 AR	40,5	22	22	23,7 x 6	7	19	20	50,5	98
S45.18 AR	40,5	18	18	20,8 x 8	8,73-11/32	20	16,5	54	108
S50.24 AR	50,5	24		27,3 x 8	10,32	20,5	22,36	61	122
S50.25 AR	50,5	25	25	28,3 x 8	10	20,5	23	61	122
S50.28 AR	50,5	28	28	30 x 8	8,8	20,5	25,5	61	122
S55.22 AR	52,5	22	22	24,8 x 6	11,9-15/32	22,5	19,2	70	140
S55.30 AR	55,5	30	30	33,3 x 8	10	25	28	70	140
S60.35 AR	60,5	35	35	38,3 x 10	10,35	25	33,4	80	160
S60.36 AR	60,5	36	36	39,3 x 10	10	25	34	80	160
S60.38 AR	60,5	38		41,3 x 10	9	25	36	80	160
S70.40 AR	65	40		43,3 x 12	10	25	38	87,5	175